

Features and Benefits

- · Four grades of magnetic materials
- · Cost effective design
- High resistance to demagnetization
- Operation from -40°C to 100°C
- Tough environmental endurance
- · Very resistant to chipping



Molded Magnet Rotor

Physical Properties of Magnetic Material

Table 1.1

| Characteristic | Value | Units |
|--------------------------------|-----------------------|-------|
| Tensile Strength | 6500 | PSI |
| Flexural Strength | 9750 | PSI |
| Flexural Modulus | 1.3 X 10 ⁶ | PSI |
| Continuous Service Temperature | 100 | °C |

Magnetic Properties

Table 1.2

| Characteristic | Magnalox 300 | Neobond 12M | Neobond 30M | Neobond 32P | Units |
|---|--------------|-------------|-------------|-------------|---------|
| Remanence (B _r) | 1370 | 2500 | 4000 | 5000 | Gauss |
| Coercive Force (H _c) | 1180 | 2400 | 3250 | 4000 | Oersted |
| Energy Product (BH _{MAX}) | 0.40 | 1.3 | 3.1 | 5.0 | MGOe |
| Intrinsic Coercive Force (H _{ci}) | 2300 | 7500 | 7000 | 7500 | Oersted |
| Reversible Temperature Coefficient (B _r) | -0.2 | -0.35 | -0.4 | -0.43 | %/deg C |
| Reversible Temperature Coefficient (H _{ci}) | +0.5 | -0.25 | -0.36 | -0.40 | %/deg C |
| Peak Magnetizing Force (>95% Saturation) | 596 | 1100 | 1600 | 1600 | kA/m |
| Specific Gravity | 3.5 | 4.0 | 4.7 | 5.0 | |

Pole Counts



Note: (N)orth/(S)outh markings are for illustration purposes and do not appear on the actual product.


Available Pole Counts


2, 4, 12

Page 1



Magnet Rotor Physical Outline - Molded (Design Style A)

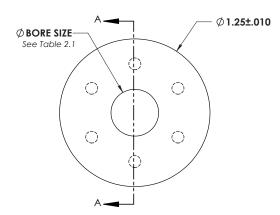

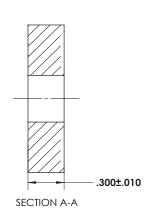

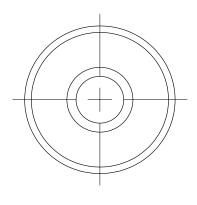


Table 2.1


| Bore Size (.inch) | Motor Shaft OD Size (nominal) | NEMA Guide Shaft Tolerance | Magnet Bore MIN. (inch) | Magnet Bore MAX. (inch) |
|-------------------------|----------------------------------|-------------------------------|----------------------------------|----------------------------------|
| 396 | 2 mm (.396") | +0.0000"/-0.0005" | .395 | .398 |

Other bore sizes available upon request. Contact sales@phoenixamerica.com.

Magnet Rotor Mounting Guidelines - Molded (Design Style A) For Slip Fit Application

- Proper alignment of the magnet rotor is critical for optimal performance.
- A machined step on the motor shaft provides a quick and repeatable method for positioning the magnet rotor. Spacers or other fixturing should be used to properly position the rotor if no mechanical locating features are on the shaft.
- Various adhesives can be used to bond the magnet rotor to the motor shaft. Shaft alloys, operating environment, and shaft speed
 and acceleration should be taken into consideration when selecting an appropriate bonding agent. Loctite threadlockers and retaining
 compounds have proved effective in bonding the magnet rotor to the motor shaft. Loctite 263 and 2760 threadlockers and Loctite
 638 and 680 retaining compounds are good candidates. These materials have been effective in past experience; testing under actual
 operating conditions should be used to qualify any bonding material.
- For best results, the motor shaft should be clean and free of any oils, lubricants, or solvents.
- Apply adhesive around the leading edge of the shaft and inside the hole in the rotor. Use a rotating motion when assembling the magnet
 to the shaft to insure good adhesive coverage.
- The use of primers and activators can be used to improve bond strength and cure rate.
- For non-critical applications or for fast bonding for evaluation, a cyanoacrylate adhesive (super glue) can be used. Loctite 401 and 410 have proven effective for quick bonding applications.



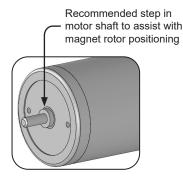


Page 2

Within USA: 1 888 801 1422 Outside USA: +1 260 432 9664



Part Number Description

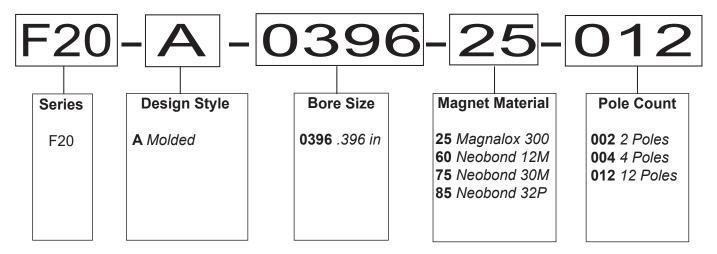

Example: F20-A-0396-25-012